BX-ARSL12 Packing Instruction

4G/Y11.1/S/14
CAN/UPI 2-3126

Shipper must ensure compatibility with all packaging materials and follow all appropriate transport regulations. For air shipment of liquids, containers must meet pressure, secondary closure and leak-proof liner requirements (See IATA DGR Section 5 / ICAO TI Section 4). Deviations from any part of this instruction may void the UN certification. Please consult 49 CFR for United States record retention requirements, as applicable. More information can be obtained by visiting: www.upwardpackaging.com; or via email: info@upwardpackaging.com

Packaging Components:

- 1 Corrugated Carton (BX-ARSL12)
- 1 Liner bag (12" x 10" x 24")
- 2 large partition inserts
- 3 small partition inserts
- 3M # 305 48mm clear tape (or equivalent)*

*Sold Separately

Assembly Instructions:

1. Fold flaps on bottom of carton. (See Figure 1)
2. Seal bottom of carton with three strips of 48mm wide, 3M #305 clear packing tape (or equivalent), in an "H" pattern. Extend tape beyond each edge by at least 3". (See Figure 2)
3. Line carton with included liner bag.
4. Assemble partition with the three small inserts intersecting the two large inserts. (See Figure 3)
5. Place the partition into the carton. Place one aerosol can into each partition cell. (See Figure 4)
6. Fold the liner bag over the partition (small edge first) and seal the liner with one strip of tape.
7. Fold flaps on top of carton and seal with three strips of tape in an "H" pattern. Extend tape beyond each edge by at least 3". (See Figure 5) **Note: maximum gross weight of package = 11.1kg**
8. Mark and label in accordance with appropriate regulations. At least one set of UN markings and both orientation arrows must not be obstructed by hazard labels or other markings.
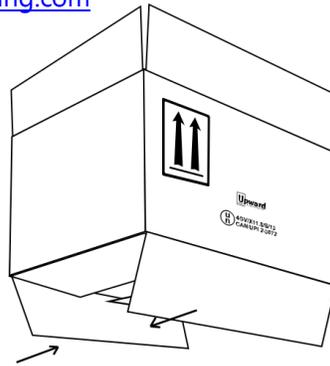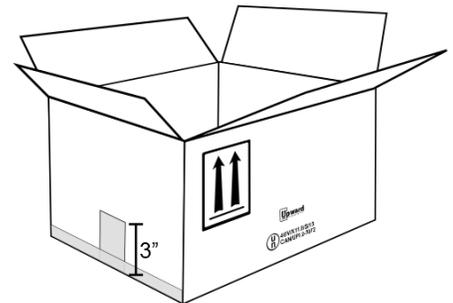

Figure 1

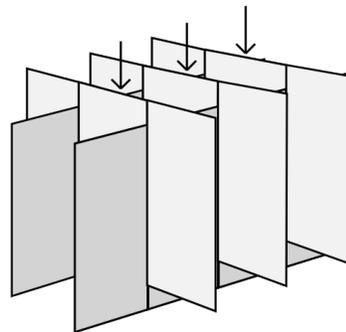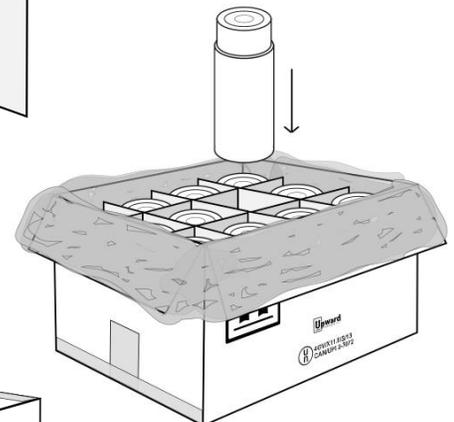**Figure 2**

Figure 3

Figure 4

Figure 5

Upward Packaging Inc.